



Canopy the Tree Experts Pty Ltd
PO Box 4464 Kingston ACT 2604
P: +61 2 6161 180
E: tree@canopygroup.com.au
E: bruno@canopygroup.com.au



12 September 2024

Job Reference #: 10105

Preliminary Arboricultural Report

Kingston Arts Precinct, Kingston ACT



Client Name:

Lucinda Arundel, Tanja Klocker, Matt Pirrie
NH Architecture

Author:

Bruno Wright
Consulting Arborist
Arboriculture Australia member

Brief

The author has been asked to conduct a site visit and carry out an arboricultural assessment of all trees in and around the boundaries of the Kingston Arts Precinct and prepare a Preliminary Arboricultural Report (survey). This report will provide information about overall health, size, condition, quality, spread, TPZ and SRZ.

Method and limits

A limited Visual Tree Assessment (VTA)¹ was performed from the ground on all trees and only includes what was visible at the time of inspection.

Trees have been plotted and numbered using Fulcrum software.

Health has been determined using the information found in the fourth column of the table at the end of this report.

The condition has been determined using the matrix provided in the fifth column of the table at the end of this report.

The quality has been determined using the information provided in the sixth column of the table at the end of this report.

The circumference was measured at 1.4 metres above ground level, with the sum being taken for multiple stems. The Diameter at Breast Height (DBH) was then calculated from this figure.

Where the tree was in a planter box, DBH was 1.4 from the visible base of the tree above the planter box.

The Tree Protection Zone (TPZ) for all trees is calculated at $DBH \times 12$ metres, as per the method described in the AS4790-2009 Protection of Trees on Development Sites.

The ACT Tree Protection Zone (ACT-ITPZ) as defined in the ACT Urban Forest ACT 2023 is the vertical projection of the canopy plus 2 meters. The ACT legislation also states that, *if another protection zone is defined in a tree management plan in force for the protected tree, that protection zone is the protection zone for the tree*. As this is a Preliminary Arboricultural Report and not a Tree Management Plan, the TPZ type has yet to be determined.

The Indicative Structural Root Zone (ISRZ) has been calculated using the formula $R_{srz} = (DGL \times 50) \times 0.42 \times 0.64$ as indicated in AS4970-2009 Protection of trees on development sites.

The identifications made have been based on the broad features visible from the ground at the time of assessment and not on full taxonomical inspections.



Definitions of Protected, Registered and Regulated Trees are described in the *ACT Urban Forest ACT 2023*. In short, all trees in public spaces are protected regardless of size. Regulated trees are trees conforming to specific dimensions on leased land. Registered trees have been identified as of high significance and are placed on a register which is available online.

Observations

392 tree locations were recorded on and around the area of the Kingston Arts Precinct to that has planned upgrades. Overall, the trees are in good health and condition. A detailed table of all the trees can be found on the following page.

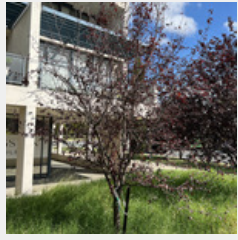
Preliminary Assessment Report



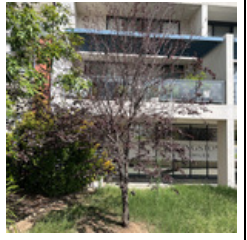
Address: Kingston Art Precinct



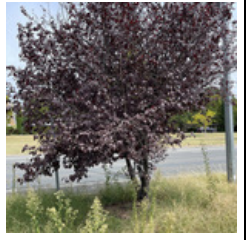
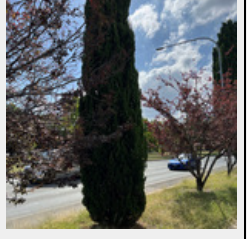
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
1	Acacia dealbata - Silver Wattle	10	Reasonable	Good	Medium	Advanced Mature	78.54	yes	3	1.92	10	25.01	27.51	8	10-30 years		
2	Eucalyptus sp. - Gum Tree	7	Reasonable	Poor	Poor	Mature	125.66	yes	4.8	2.34	10	40.02	44.02	8	5-10 years	Stump re growth	
3	Prunus 'Nigra' - Purple Cherry-Plum	5	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
4	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		

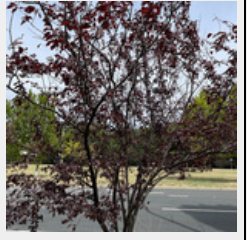
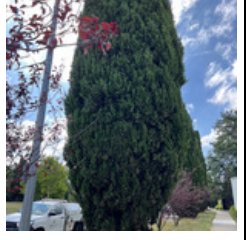
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
5	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
6	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Good	Good	High	Mature	62.83	yes	2.4	1.75	7	20.01	22.01	5	10-30 years		
7	Prunus 'Nigra' - Purple Cherry-Plum	3	Good	Good	High	Mature	62.83	yes	2.4	1.75	7	20.01	22.01	5	10-30 years		
8	Cupressus sempervirens 'Stricta' - Italian Cypress	8	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	4	15.01	16.51	2	10-30 years		

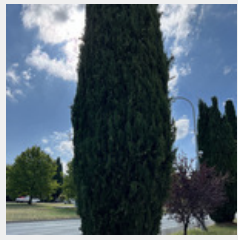
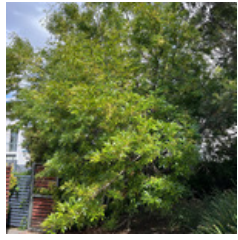
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
9	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Good	Good	High	Mature	78.54	yes	3	1.92	8	25.01	27.51	6	10-30 years		
10	Prunus 'Nigra' - Purple Cherry-Plum	5	Poor	Very Poor	Poor	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	<5 years		
11	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	78.54	yes	3	1.92	8	25.01	27.51	6	10-30 years		
12	Cupressus sempervirens 'Stricta' - Italian Cypress	8	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	4	15.01	16.51	2	10-30 years		

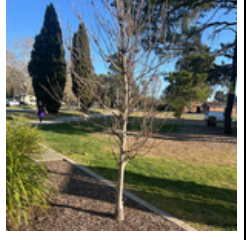
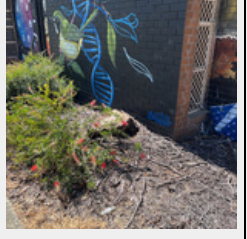
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
13	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	78.54	yes	3	1.92	8	25.01	27.51	6	10-30 years		
14	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
15	Cupressus sempervirens 'Stricta' - Italian Cypress	13	Reasonable	Good	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	10-30 years		
16	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		

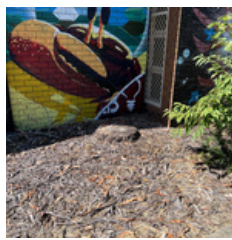
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
17	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
18	Cupressus sempervirens 'Stricta'. - Italian Cypress	13	Reasonable	Good	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	10-30 years		
19	Fraxinus sp. - Ash	8	Reasonable	Good	High	Mature	78.54	yes	3	1.92	12	25.01	27.51	10	10-30 years		
20	Cupressus sempervirens 'Stricta'. - Italian Cypress	15	Reasonable	Good	High	Advanced Mature	376.99	yes	14.41	3.72	4	120.06	132.07	20	10-30 years		

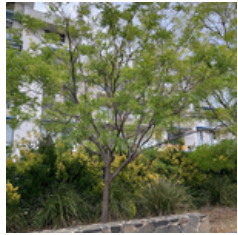
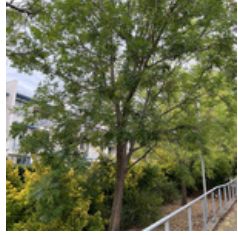
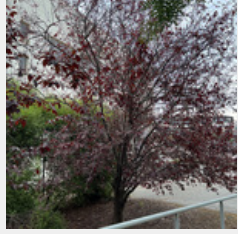
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
21	Cupressus sempervirens 'Stricta' - Italian Cypress	17	Reasonable	Good	High	Mature	157.08	yes	6	2.58	4	50.03	55.03	2	10-30 years		
22	Fraxinus 'Raywood' - Claret Ash	4	Good	Good	High	Semi-Mature	6.28	yes	0.24	0.67	4.5	2	2.2	2.5	10-30 years		
23	Fraxinus sp. - Ash	5	Moderate	Poor	Poor	Juvenile	12.57	yes	0.48	0.89	5	4	4.4	3			
24					Removed			no								On plan but Removed	

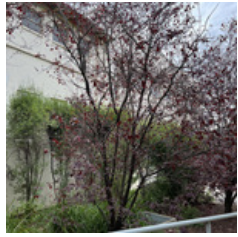
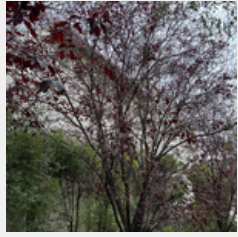
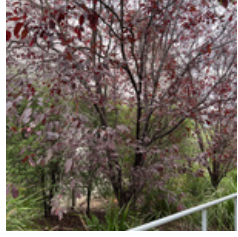
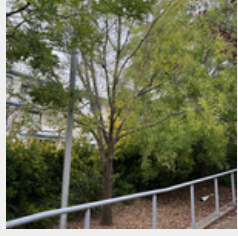
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
25			removed	Removed	Removed			no								On plan but Removed	
26					removed			no								On plan but Removed	
27	Styphnolobium japonicum - Pagoda tree	10	Reasonable	Fair	Medium	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
28	Styphnolobium japonicum - Pagoda tree	5	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years	Obstructing light post. Suppressed by a neighbouring tree, 27	

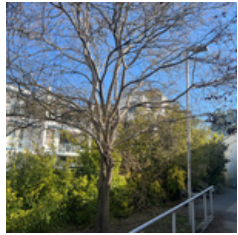
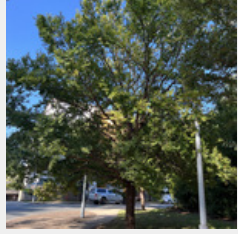
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
29	Styphnolobium japonicum - Pagoda tree	6	Moderate	Fair	Medium	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
30	Styphnolobium japonicum - Pagoda tree	9	Reasonable	Fair	Medium	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years	Obstructing light post.	
31	Styphnolobium japonicum - Pagoda tree	9	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
32	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		

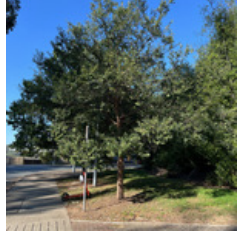
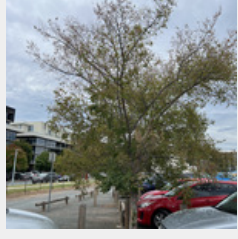
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
33	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
34	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
35	Prunus 'Nigra' - Purple Cherry-Plum	5	Reasonable	Good	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
36	Styphnolobium japonicum - Pagoda tree	8	Moderate	Fair	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
37	Styphnolobium japonicum - Pagoda tree		Reasonable	Good	High	Mature	76	yes	2.9	1.9	11	24.2	26.62	9	10-30 years		
38	Styphnolobium japonicum - Pagoda tree	9	Reasonable	Good	High	Mature	140	yes	5.35	2.45	10	44.59	49.04	8	10-30 years	branches are obstructing streetlight	
39	Casuarina cunninghamiana - River Oak	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
40	Ulmus parvifolia - Chinese Elm	10	Good	Good	High	Mature	109.96	yes	4.2	2.22	14	35.02	38.52	12	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
41	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	13	30.02	33.02	11	10-30 years		
42	Ulmus parvifolia - Chinese Elm	11	Good	Good	High	Mature	94.25	yes	3.6	2.08	14	30.02	33.02	12	10-30 years		
43	Ulmus parvifolia - Chinese Elm	8	Good	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
44	Ulmus parvifolia - Chinese Elm	7	Moderate	Fair	Medium	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		

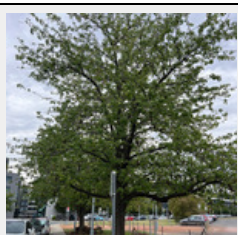
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
45	Ulmus parvifolia - Chinese Elm	7	Poor	Poor	Poor	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
46	Ulmus parvifolia - Chinese Elm	6	Moderate	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	5-10 years		
47	Ulmus parvifolia - Chinese Elm	6	Reasonable	Good	High	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
48	Ulmus parvifolia - Chinese Elm	6	Poor	Poor	Poor	Mature	37.7	yes	1.44	1.41	8	12.01	13.21	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
49	Ulmus parvifolia - Chinese Elm	6	Poor	Poor	Poor	Mature	37.7	yes	1.44	1.41	8	12.01	13.21	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
50	Ulmus parvifolia - Chinese Elm	6	Poor	Poor	Poor	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
51	Ulmus parvifolia - Chinese Elm	6	Poor	Poor	Poor	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
52	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	11	20.01	22.01	9	10-30 years		

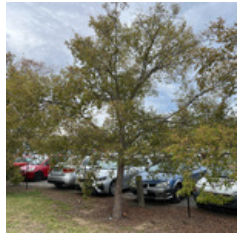
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
53	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	11	15.01	16.51	9	10-30 years		
54	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	13	30.02	33.02	11	10-30 years		
55	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	13	35.02	38.52	11	10-30 years		
56	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years		

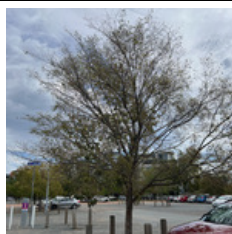
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
57	Pyrus ussuriensis - Manchurian Pear	12	Reasonable	Good	High	Mature	141.37	yes	5.4	2.46	15	45.02	49.52	13	10-30 years		
58	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	>30 years	Leaf appearance suggests recent waterlogging due to local topography	
59	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
60	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
61	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
62	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
63	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	10	15.01	16.51	8	10-30 years		
64	Ulmus parvifolia - Chinese Elm	7	Reasonable	Fair	Medium	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		

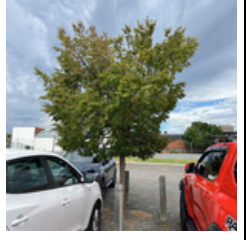
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
65	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	10	15.01	16.51	8	10-30 years		
66	Ulmus parvifolia - Chinese Elm	6	Reasonable	Fair	Medium	Mature	37.7	yes	1.44	1.41	9	12.01	13.21	7	10-30 years		
67	Ulmus parvifolia - Chinese Elm	7	Moderate	Poor	Medium	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	5-10 years	Sparse crown	
68	Ulmus parvifolia - Chinese Elm	6	Moderate	Poor	Poor	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	

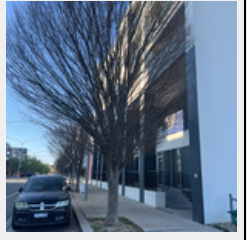
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
69	Ulmus parvifolia - Chinese Elm	6	Moderate	Fair	Poor	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
70	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	Medium	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	10-30 years		
71	Ulmus parvifolia - Chinese Elm	7	Moderate	Fair	Medium	Mature	47.12	yes	1.8	1.55	9	15.01	16.51	7	10-30 years		
72	Ulmus parvifolia - Chinese Elm	6	Reasonable	Fair	Medium	Mature	37.7	yes	1.44	1.41	9	12.01	13.21	7	10-30 years		

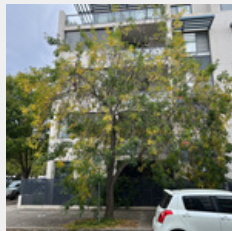
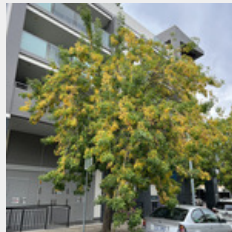
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
73	Ulmus parvifolia - Chinese Elm	6	Reasonable	Good	High	Mature	37.7	yes	1.44	1.41	9	12.01	13.21	7	10-30 years		
74	Ulmus parvifolia - Chinese Elm	6	Moderate	Fair	Medium	Mature	37.7	yes	1.44	1.41	9	12.01	13.21	7	10-30 years		
75	Ulmus parvifolia - Chinese Elm	6	Reasonable	Good	High	Mature	31.42	yes	1.2	1.31	9	10.01	11.01	7	10-30 years		
76	Ulmus parvifolia - Chinese Elm	6	Moderate	Fair	Medium	Mature	31.42	yes	1.2	1.31	9	10.01	11.01	7	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
77	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	11	20.01	22.01	9	10-30 years		
78	Zelkova serrata - Zelkova	9.8	Good	Good	High	Mature	126	yes	4.82	2.35	10	40.13	44.14	8	10-30 years		
79	Ulmus parvifolia - Chinese Elm	9	Reasonable	Fair	Medium	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years	root ball is pushing up as mass increases. May become unstable in the future. Monitor.	
80	koelreuteria species	5	Reasonable	Good	High	Mature	78.54	yes	3	1.92	12	25.01	27.51	10	10-30 years		

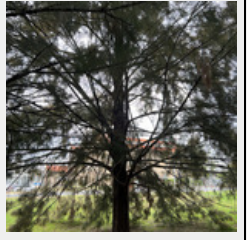
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
81	Pyrus ussuriensis - Manchurian Pear	12	Reasonable	Good	High	Advanced Mature	204.2	yes	7.8	2.88	19	65.03	71.54	17	10-30 years	Previous branch failures are evident. Recommend weight reduction pruning to prevent future branch failures at acute forks. Pruning specifications must be advised by an AQF 5 arborist.	
82	Fraxinus pennsylvanica - Green Ash	9	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	12	30.02	33.02	10	10-30 years	Branches are partially obstructing parking sign. Roots disrupting pavement	
83	Fraxinus pennsylvanica - Green Ash	9	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	12	30.02	33.02	10	10-30 years	Branches are partially obstructing parking sign. Roots disrupting pavement	
84	Fraxinus pennsylvanica - Green Ash	8	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	12	30.02	33.02	10	10-30 years	Branches are partially obstructing parking sign. Roots disrupting pavement	

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
85	Fraxinus pennsylvanica - Green Ash	8	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	12	30.02	33.02	10	10-30 years	Branches are partially obstructing parking sign. Roots disrupting pavement	
86	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	14	30.02	33.02	12	10-30 years		
87	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	14	30.02	33.02	12	10-30 years		
88	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	16	35.02	38.52	14	10-30 years		

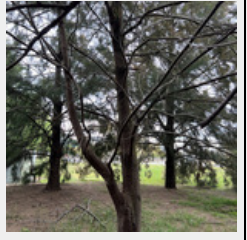
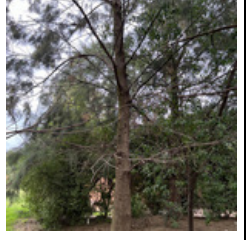
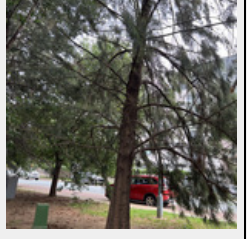
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
89	Casuarina cunninghamiana - River Oak	16	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	12	40.02	44.02	10	10-30 years		
90	Casuarina cunninghamiana - River Oak	16	Reasonable	Good	High	Mature	157.08	yes	6	2.58	15	50.03	55.03	13	10-30 years		
91	Ulmus parvifolia - Chinese Elm	7	Moderate	Fair	Medium	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
92	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	78.54	yes	3	1.92	11	25.01	27.51	9	10-30 years		

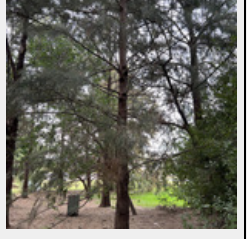
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
93	Ulmus parvifolia - Chinese Elm	6	Reasonable	Good	High	Mature	37.7	yes	1.44	1.41	9	12.01	13.21	7	10-30 years		
94	Ulmus parvifolia - Chinese Elm	9	Reasonable	Good	High	Mature	78.54	yes	3	1.92	11	25.01	27.51	9	10-30 years	located on an easement	
95	Ulmus parvifolia - Chinese Elm	5	Poor	Poor	Poor	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	5-10 years	The tree is in advanced stages of decline as a result of growing conditions in high compacted car park area	
96	Ulmus parvifolia - Chinese Elm	7	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	9	20.01	22.01	7	10-30 years		

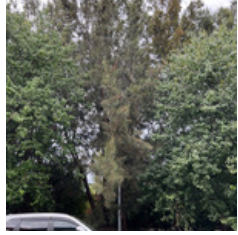
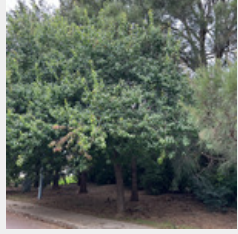
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
97	Ulmus parvifolia - Chinese Elm	8	Reasonable	Good	High	Mature	78.54	yes	3	1.92	10	25.01	27.51	8	10-30 years		
98	Casuarina cunninghamiana - River Oak	14	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years		
99	Casuarina cunninghamiana - River Oak	15	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years		
100	Casuarina cunninghamiana - River Oak	14	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	11	35.02	38.52	9	10-30 years		

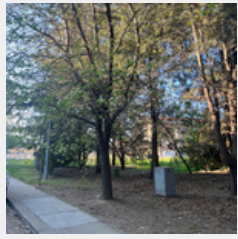
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
101	Casuarina cunninghamiana - River Oak	14	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	11	35.02	38.52	9	10-30 years		
102	Casuarina cunninghamiana - River Oak	15	Reasonable	Good	High	Advanced Mature	188.5	yes	7.2	2.78	17	60.03	66.03	15	10-30 years		
103	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Fair	Poor	Mature	47.12	yes	1.8	1.55	9	15.01	16.51	7	5-10 years	Growing on 30 degree lean. Very low use area.	
104	Casuarina cunninghamiana - River Oak	14	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	11	30.02	33.02	9	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
105	Casuarina cunninghamiana - River Oak	16	Reasonable	Good	High	Advanced Mature	314.16	yes	12.01	3.45	20	100.05	110.06	18	10-30 years		
106	Casuarina cunninghamiana - River Oak	16	Reasonable	Good	High	Mature	157.08	yes	6	2.58	12	50.03	55.03	10	10-30 years		
107	Casuarina cunninghamiana - River Oak	16	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	12	40.02	44.02	10	10-30 years	branches are obstructing streetlight	
108	Pyrus ussuriensis - Manchurian Pear	9	Reasonable	Good	High	Mature	78.54	yes	3	1.92	12	25.01	27.51	10	10-30 years	Asymmetric crown due to shading	

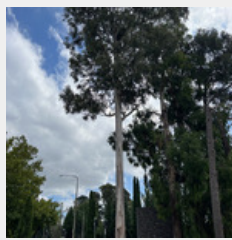
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
109	Casuarina cunninghamiana - River Oak	18	Good	Good	High	Advanced Mature	282.74	yes	10.81	3.3	19	90.04	99.05	17	10-30 years	lower branches obstruct the streetlight.	
110	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	Medium	Mature	62.83	yes	2.4	1.75	11	20.01	22.01	9	10-30 years		
111	Pyrus ussuriensis - Manchurian Pear	10	Reasonable	Good	High	Mature	78.54	yes	3	1.92	12	25.01	27.51	10	10-30 years		
112	Pyrus ussuriensis - Manchurian Pear	8	Reasonable	Good	Medium	Mature	65	yes	2.48	1.78	11	20.7	22.77	9	10-30 years		

Preliminary Assessment Report

[illegible]

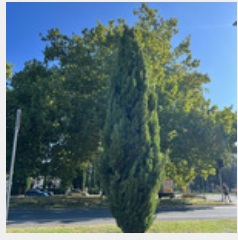
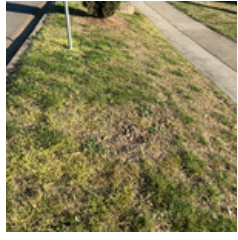
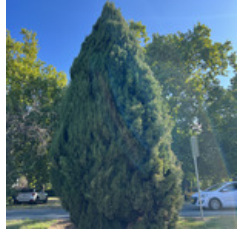
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
120	Pinus radiata - Monterey Pine	36	Good	Good	High	Advanced Mature	314.16	yes	12.01	3.45	19	100.05	110.06	17	10-30 years		
121	Eucalyptus elata - River Peppermint Gum	25	Reasonable	Fair	High	Advanced Mature	376.99	yes	14.41	3.72	14	120.06	132.07	12	10-30 years	lots of bird chewing damage on eastern side of the main trunk from halfway up. Hollows, possibly used as habitat for small mammals or birds.	
122	Eucalyptus elata - River Peppermint Gum	22	Reasonable	Good	High	Advanced Mature	314.16	yes	12.01	3.45	18	100.05	110.06	16	10-30 years		
123	Eucalyptus bicostata - Blue Gum	24	Reasonable	Good	High	Advanced Mature	376.99	yes	14.41	3.72	18	120.06	132.07	16	10-30 years		

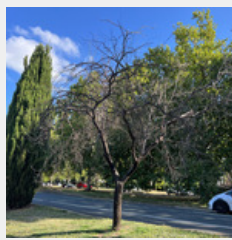
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
124								no			19			17		Dead	
125								no								Removed	
126								no								Removed	
127	Ulmus parvifolia - Chinese Elm	11	Good	Good	High	Mature	109.96	yes	4.2	2.22	14	35.02	38.52	12	10-30 years	Verge tree. Low branches over footpath.	

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
128	Cupressus sempervirens 'Stricta'. - Italian Cypress	7	Reasonable	Good	High	Mature	47.12	yes	1.8	1.55	4	15.01	16.51	2	10-30 years		
129			Reasonable	Good	High			no									
130	Cupressus sempervirens 'Stricta'. - Italian Cypress	7	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	4	20.01	22.01	2	10-30 years		
131	Cupressus sempervirens 'Stricta'. - Italian Cypress	7	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	4	20.01	22.01	2	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
132	Prunus 'Nigra' - Purple Cherry-Plum		Dead					no								Removed	
133	Cupressus sempervirens 'Stricta'. - Italian Cypress	6	Good	Good	High	Mature	65	yes	2.48	1.78	4	20.7	22.77	2	>30 years		
134	Cupressus sempervirens 'Stricta'. - Italian Cypress	8	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	4	20.01	22.01	2	10-30 years		
135	Cupressus sempervirens 'Stricta'. - Italian Cypress	7	Reasonable	Good	High	Mature	60	yes	2.29	1.72	4	19.11	21.02	2	10-30 years		

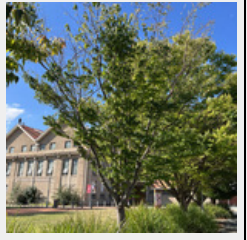
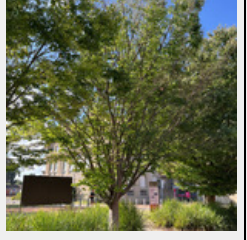
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
136	Cupressus sempervirens 'Stricta'. - Italian Cypress	1	Reasonable	Good	High	Juvenile	6	yes	0.23	0.65	4	1.91	2.1	2	10-30 years		
137	Cupressus sempervirens 'Stricta'. - Italian Cypress	12	Reasonable	Good	High	Mature	251.33	yes	9.6	3.14	4	80.04	88.05	2	10-30 years		
138	Cupressus sempervirens 'Stricta'. - Italian Cypress	15	Good	Good	High	Advanced Mature	282.74	yes	10.81	3.3	4	90.04	99.05	2	10-30 years		
139	Cupressus sempervirens 'Stricta'. - Italian Cypress	9	Poor	Poor	Poor	Mature	125.66	yes	4.8	2.34	4	40.02	44.02	2	5-10 years		

Preliminary Assessment Report

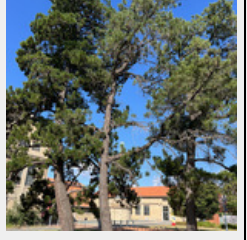
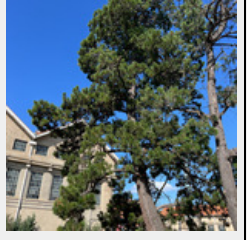
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
140	Cupressus sempervirens 'Stricta' - Italian Cypress	10	Good	Good	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	10-30 years		
141	Prunus 'Nigra' - Purple Cherry-Plum	3	Good	Good	High	Mature	9.42	yes	0.36	0.79	5.5	3	3.3	3.5	10-30 years	Need form pruning	
142	Fraxinus excelsior 'Aurea' - Golden Ash	4	Reasonable	Good	High	Semi-Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
143	Zelkova serrata - Zelkova	6	Poor	Poor	Poor	Mature	47.12	yes	1.8	1.55	9	15.01	16.51	7	5-10 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
144	Zelkova serrata - Zelkova	6	Moderate	Fair	Medium	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	5-10 years		
145	Zelkova serrata - Zelkova	8	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	13	40.02	44.02	11	10-30 years		
146	Zelkova serrata - Zelkova	8	Moderate	Fair	Medium	Mature	125.66	yes	4.8	2.34	12	40.02	44.02	10	5-10 years		
147	Zelkova serrata - Zelkova	8	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years		

Preliminary Assessment Report

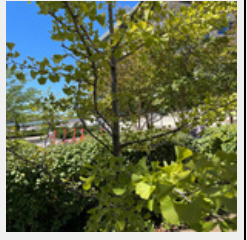
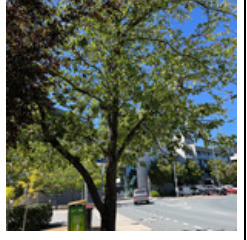
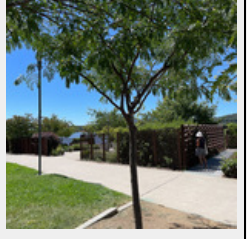


Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
148	Fraxinus sp. - Ash	12	Reasonable	Good	High	Mature	141.37	yes	5.4	2.46	16	45.02	49.52	14	10-30 years	Olive Lace Bug infestation causing leaf drop	
149	Pinus radiata - Monterey Pine	19	Reasonable	Good	High	Advanced Mature	251.33	yes	9.6	3.14	21	80.04	88.05	19	10-30 years		
150	Pinus radiata - Monterey Pine	19	Poor	Poor	Poor	Advanced Mature	188.5	yes	7.2	2.78	16	60.03	66.04	14	<5 years	Showing advanced decline	
151								no								Removed	
152	Pinus radiata - Monterey Pine	24	Reasonable	Good	High	Advanced Mature	345.58	yes	13.21	3.59	20	110.06	121.06	18	10-30 years		

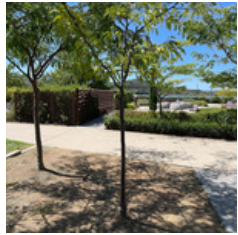
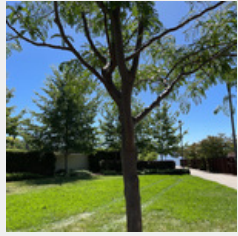
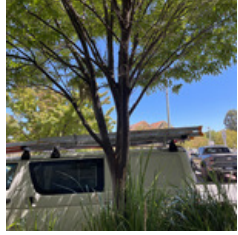
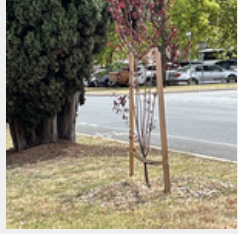
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
153								no								Removed	
200	Cupressus sempervirens 'Stricta' - Italian Cypress	3	Good	Good	High	Juvenile	6.28	yes	0.24	0.67	4	2	2.2	2	>30 years		
201	Platanus orientalis - Oriental Plane Tree	11	Good	Good	High	Mature	125.66	yes	4.8	2.34	20	40.02	44.02	18	>30 years		
202	Ginkgo Biloba	3	Good	Good	High	Semi-Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		

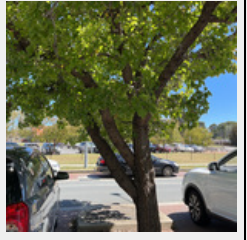
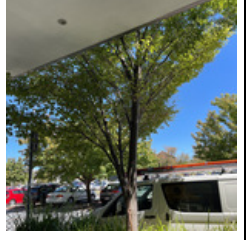
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
203	Ginkgo Biloba	2	Good	Good	High	Semi-Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		
204	Ginkgo Biloba	3	Reasonable	Good	High	Semi-Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		
205	Pyrus ussuriensis - Manchurian Pear	9	Good	Good	High	Mature	87.96	yes	3.36	2.02	10	28.01	30.81	8	10-30 years		
206	Gleditsia triacanthos - Honey locust	3	Good	Good	High	Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		

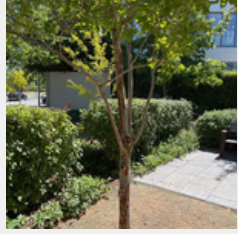
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
207	Gleditsia triacanthos - Honey locust	2.5	Good	Good	High	Semi-Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		
208	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	12.57	yes	0.48	0.89	6	4	4.4	4	10-30 years		
209	Zelkova serrata - Zelkova	7	Good	Good	High	Mature	43.98	yes	1.68	1.51	8	14.01	15.41	6	10-30 years		
210	Prunus 'Nigra' - Purple Cherry-Plum	2	Good	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	>30 years		

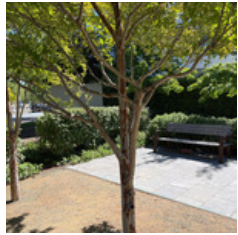
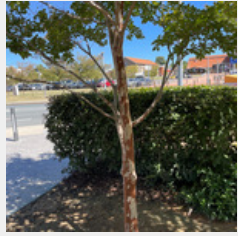
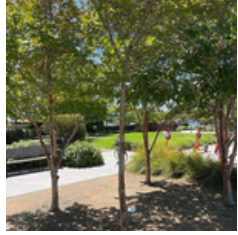
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
211	Prunus 'Nigra' - Purple Cherry-Plum	2	Good	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	>30 years		
212	Pyrus ussuriensis - Manchurian Pear	5.5	Good	Good	High	Mature	87.96	yes	3.36	2.02	8	28.01	30.81	6	10-30 years		
213	Zelkova serrata - Zelkova	7	Good	Good	High	Mature	40.84	yes	1.56	1.46	8	13.01	14.31	6	10-30 years		
214	Zelkova serrata - Zelkova	7	Good	Good	High	Mature	50.27	yes	1.92	1.6	8	16.01	17.61	6	10-30 years		

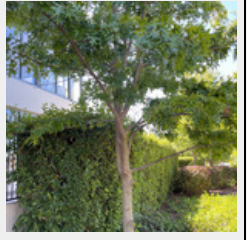
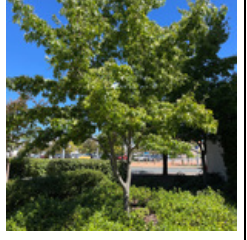
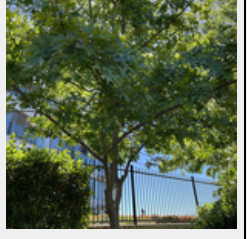
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
215	Zelkova serrata - Zelkova	7.5	Good	Good	High	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
216	Zelkova serrata - Zelkova	7.5	Good	Good	High	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
217	Platanus x acerifolia - London Plane Tree	9	Good	Good	High	Mature	69.12	yes	2.64	1.82	10	22.01	24.21	8	>30 years		
218	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		

Preliminary Assessment Report

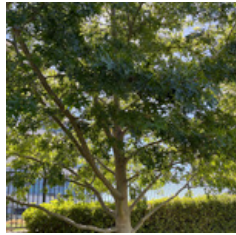
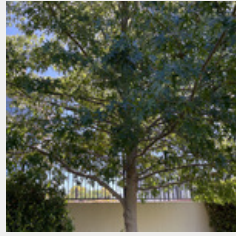
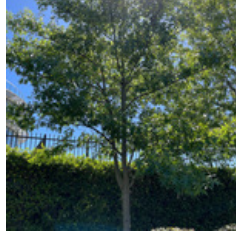
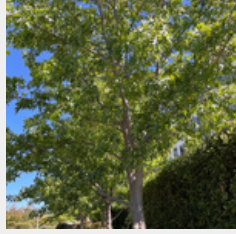
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
219	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		
220	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		
221	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		
222	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		

Preliminary Assessment Report

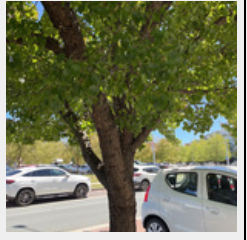
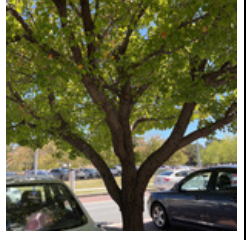
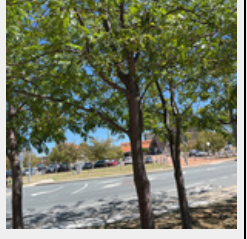
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
223	Largestroemia indica - Crepe Myrtle	3	Good	Good	High	Mature	15.71	yes	0.6	0.98	5.5	5	5.5	3.5	10-30 years		
224	Quercus palustris - Pin Oak	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		
225	Quercus palustris - Pin Oak	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		
226	Quercus palustris - Pin Oak	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		

Preliminary Assessment Report

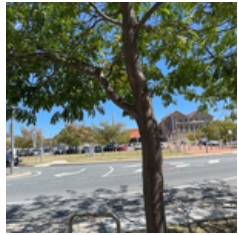
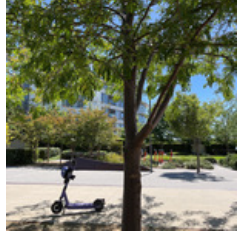
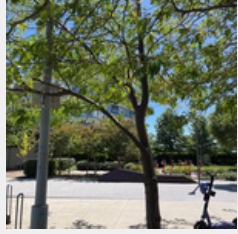


Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
227	Quercus palustris - Pin Oak	5	Good	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	>30 years		
228	Quercus palustris - Pin Oak	5	Good	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	>30 years		
229	Quercus palustris - Pin Oak	5	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		
230	Quercus palustris - Pin Oak	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
231	Quercus palustris - Pin Oak	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	>30 years		
232	Pyrus ussuriensis - Manchurian Pear	7	Good	Good	High	Mature	65.97	yes	2.52	1.79	11	21.01	23.11	9	10-30 years		
233	Pyrus ussuriensis - Manchurian Pear	7	Good	Good	High	Mature	94.25	yes	3.6	2.08	12	30.02	33.02	10	10-30 years		
234	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	10-30 years		

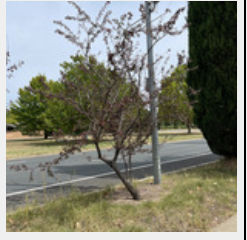
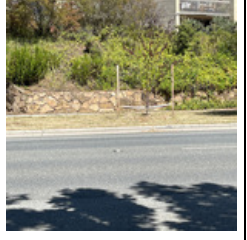
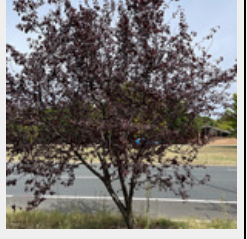
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
235	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	10-30 years		
236	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	10-30 years	Tree is obstructing light post	
237	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	34.56	yes	1.32	1.36	8	11.01	12.11	6	10-30 years		
238	Gleditsia triacanthos - Honey locust	4	Good	Good	High	Mature	28.27	yes	1.08	1.25	7	9	9.9	5	10-30 years	Tree is obstructing light post	

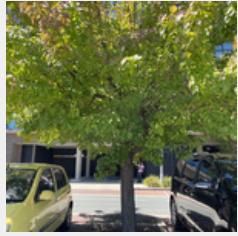
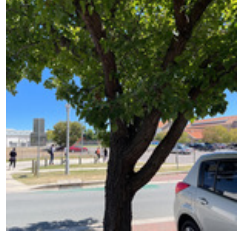
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
239	Platanus x acerifolia - London Plane Tree	9	Good	Good	High	Mature	78.54	yes	3	1.92	12	25.01	27.51	10	>30 years		
240	Platanus x acerifolia - London Plane Tree	5	Good	Good	High	Mature	50.27	yes	1.92	1.6	9	16.01	17.61	7	>30 years		
241	Prunus 'Nigra' - Purple Cherry-Plum	2	Good	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	>30 years		
242	Prunus 'Nigra' - Purple Cherry-Plum	2	Good	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	>30 years		

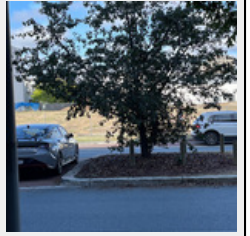
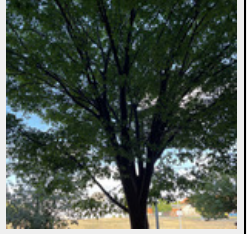
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
244	Prunus 'Nigra' - Purple Cherry-Plum	2	Good	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	10-30 years		
245	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
246	Prunus 'Nigra' - Purple Cherry-Plum	2	Reasonable	Good	High	Juvenile	9.42	yes	0.36	0.79	5	3	3.3	3	10-30 years		
247	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
256	Zelkova serrata - Zelkova	4	Good	Good	High	Mature	37.7	yes	1.44	1.41	7	12.01	13.21	5	10-30 years		
257	Pyrus ussuriensis - Manchurian Pear	6	Good	Good	High	Mature	62.83	yes	2.4	1.75	8	20.01	22.01	6	10-30 years		
258	Pyrus ussuriensis - Manchurian Pear	5.1	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
259	Pyrus ussuriensis - Manchurian Pear	6	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		

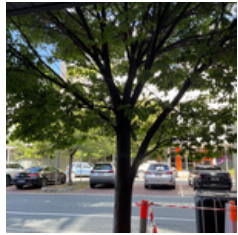
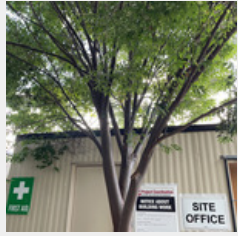
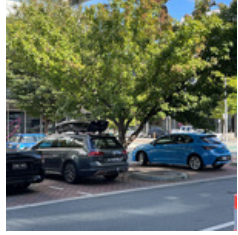
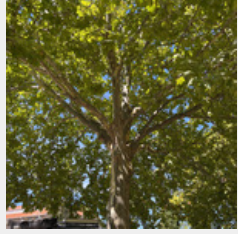
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
261	Pyrus ussuriensis - Manchurian Pear	5	Good	Good	High	Mature	69.12	yes	2.64	1.82	8	22.01	24.21	6	10-30 years	Tree is obstructing emergency vehicle sign.	
262	Pyrus ussuriensis - Manchurian Pear	6	Moderate	Poor	Medium	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	10-30 years	Tree appears to have leaves dying off before the other trees in the same area. Suspect due to change in season.	
263	Zelkova serrata - Zelkova	6.8	Good	Good	High	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	10-30 years		
264	Zelkova serrata - Zelkova	6.8	Good	Good	High	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	10-30 years		

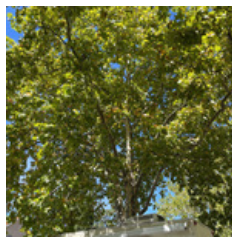
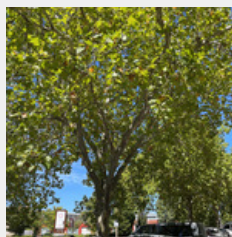
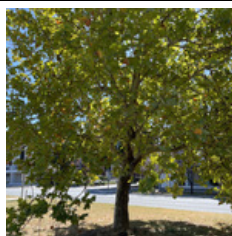
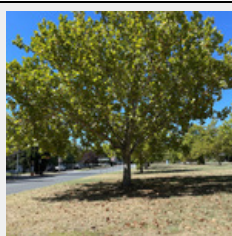
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
265	Zelkova serrata - Zelkova	8	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
266	Zelkova serrata - Zelkova	1.2	Good	Good	High	Semi-Mature	9.42	yes	0.36	0.79	5	3	3.3	3	10-30 years	Tree still has stakes, though they are not attached.	
267	Cupressus sempervirens 'Stricta' - Italian Cypress	13	Good	Good	High	Mature	188.5	yes	7.2	2.78	4	60.03	66.04	2	>30 years		
268			Dead					no			12			10		Dead	

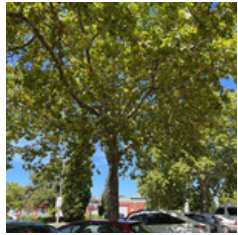
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
269	Zelkova serrata - Zelkova	6	Good	Good	High	Mature	31.42	yes	1.2	1.31	8.5	10.01	11.01	6.5	10-30 years		
270	Zelkova serrata - Zelkova	6.5	Good	Good	High	Mature	78.54	yes	3	1.92	8.5	25.01	27.51	6.5	10-30 years	Previous lower limb has been removed.	
271	Pyrus ussuriensis - Manchurian Pear	8	Good	Good	High	Mature	125.66	yes	4.8	2.34	10	40.02	44.02	8	10-30 years	wound from previous snapped off branch.	
272	Platanus x acerifolia - London Plane Tree	15.8	Good	Good	High	Advanced Mature	188.5	yes	7.2	2.78	20	60.03	66.04	18	>30 years		

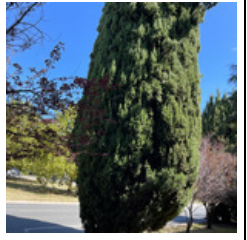
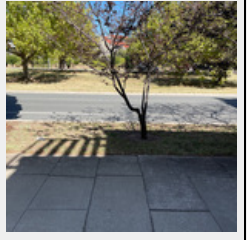
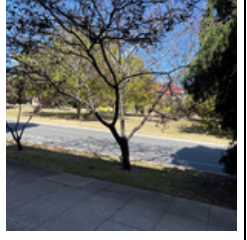
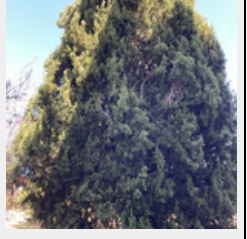
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
273	Platanus x acerifolia - London Plane Tree	16.7	Good	Good	High	Advanced Mature	157.08	yes	6	2.58	18	50.03	55.03	16	>30 years		
274	Platanus x acerifolia - London Plane Tree	17	Good	Good	High	Advanced Mature	147.65	yes	5.64	2.51	16	47.02	51.72	14	>30 years		
275	Platanus x acerifolia - London Plane Tree	9.2	Good	Good	High	Mature	122.52	yes	4.68	2.32	14	39.02	42.92	12	>30 years		
276	Platanus x acerifolia - London Plane Tree	12.5	Good	Good	High	Mature	131.95	yes	5.04	2.39	16	42.02	46.22	14	>30 years		

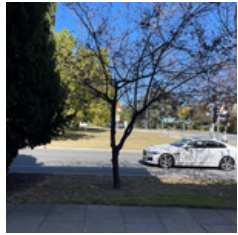
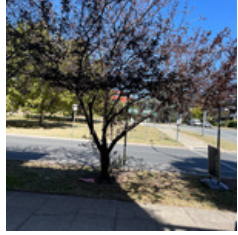
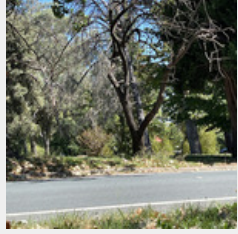
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
277	Platanus x acerifolia - London Plane Tree	16.8	Good	Good	High	Advanced Mature	138.23	yes	5.28	2.44	16	44.02	48.42	14	>30 years		
278	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	179.07	yes	6.84	2.72	15	57.03	62.73	13	>30 years		
279	Prunus 'Nigra' - Purple Cherry-Plum	4.3	Good	Good	High	Mature	56.55	yes	2.16	1.68	8	18.01	19.81	6	10-30 years		
280	Platanus orientalis - Oriental Plane Tree	20.8	Reasonable	Good	High	Juvenile	235.62	yes	9	3.05	17	75.04	82.54	15	>30 years	Original tree is no longer present, new juvenile tree is sprouting from the old roots.	

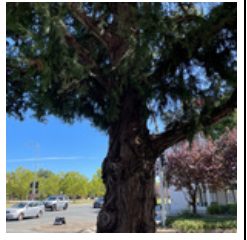
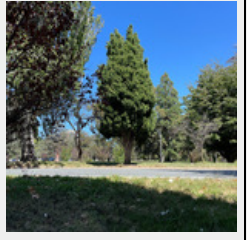
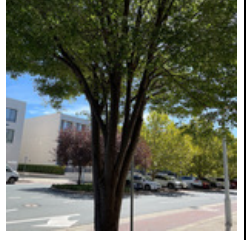
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
281	Cupressus sempervirens 'Stricta' - Italian Cypress	12.4	Good	Good	High	Advanced Mature	229.34	yes	8.76	3.02	4	73.04	80.34	2	>30 years		
282	Prunus 'Nigra' - Purple Cherry-Plum	4.3	Good	Good	High	Mature	53.41	yes	2.04	1.64	7	17.01	18.71	5	10-30 years		
283	Prunus 'Nigra' - Purple Cherry-Plum	5.6	Good	Good	High	Mature	84.82	yes	3.24	1.99	9	27.01	29.71	7	10-30 years		
284	Cupressus sempervirens 'Stricta' - Italian Cypress	9.9	Good	Good	High	Advanced Mature	320.44	yes	12.25	3.47	4	102.05	112.26	2	>30 years		

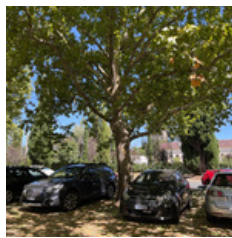
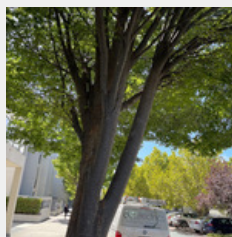
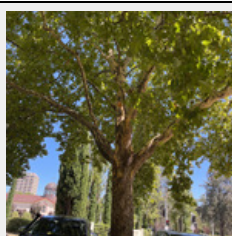
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
285	Prunus 'Nigra' - Purple Cherry-Plum	6	Good	Good	High	Mature	53.41	yes	2.04	1.64	9	17.01	18.71	7	10-30 years		
286	Populus alba - Silver Poplar	15.2	Good	Good	High	Mature	219.91	yes	8.4	2.97	18	70.04	77.04	16	>30 years		
287	Prunus 'Nigra' - Purple Cherry-Plum	5.3	Good	Good	High	Mature	91.11	yes	3.48	2.05	7	29.02	31.92	5	10-30 years		
288	Prunus 'Nigra' - Purple Cherry-Plum		Dead					no			12			10		Dead	

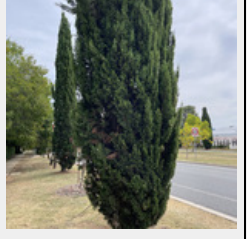
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
289	Cupressus torulosa - Bhutan Cypress	17.7	Good	Good	High	Advanced Mature	342.43	yes	13.09	3.57	14	109.05	119.96	12	>30 years		
290	Cupressus sempervirens 'Stricta' - Italian Cypress	10.8	Good	Good	High	Mature	172.79	yes	6.6	2.68	4	55.03	60.53	2	>30 years		
291	Zelkova serrata - Zelkova	8.7	Good	Good	High	Mature	91.11	yes	3.48	2.05	10	29.02	31.92	8	10-30 years		
293	Platanus x acerifolia - London Plane Tree	18	Good	Good	High	Advanced Mature	172.79	yes	6.6	2.68	22	55.03	60.53	20	>30 years		

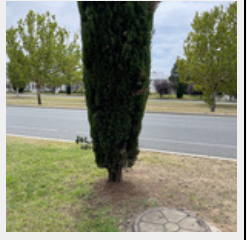
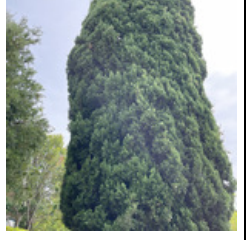
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
295	Platanus x acerifolia - London Plane Tree	18	Good	Good	High	Advanced Mature	172.79	yes	6.6	2.68	22	55.03	60.53	20	>30 years	Small dead hanging branches over car parks	
296	Zelkova serrata - Zelkova	10.3	Good	Good	High	Mature	87.96	yes	3.36	2.02	14	28.01	30.81	12	10-30 years		
297	Cupressus sempervirens 'Stricta' - Italian Cypress	8.4	Good	Good	High	Mature	62.83	yes	2.4	1.75	4	20.01	22.01	2	>30 years		
298	Platanus x acerifolia - London Plane Tree	18	Good	Good	High	Advanced Mature	172.79	yes	6.6	2.68	22	55.03	60.53	20	>30 years		

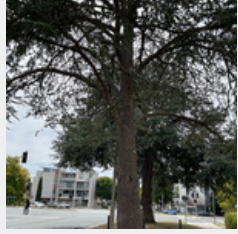
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
299	Prunus 'Nigra' - Purple Cherry-Plum	4.4	Reasonable	Good	High	Mature	37.7	yes	1.44	1.41	7	12.01	13.21	5	10-30 years		
300	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Reasonable	Good	High	Mature	72.26	yes	2.76	1.86	8	23.01	25.31	6	10-30 years		
301	Cupressus sempervirens 'Stricta'. - Italian Cypress	6.3	Good	Good	High	Mature	31.42	yes	1.2	1.31	4	10.01	11.01	2	>30 years		
302	Cupressus sempervirens 'Stricta'. - Italian Cypress	4.4	Good	Good	High	Mature	31.42	yes	1.2	1.31	4	10.01	11.01	2	>30 years		

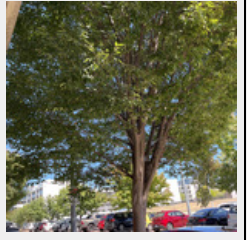
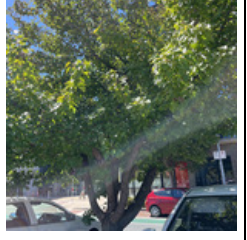
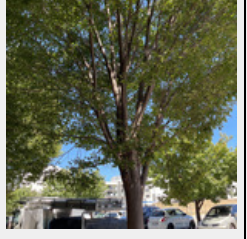
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
303								no								Removed	
304	Cupressus sempervirens 'Stricta'. - Italian Cypress	4.8	Good	Good	High	Mature	31.42	yes	1.2	1.31	4	10.01	11.01	2	>30 years		
305	Cupressus sempervirens 'Stricta'. - Italian Cypress	10.8	Good	Good	High	Advanced Mature	235.62	yes	9	3.05	4	75.04	82.54	2	>30 years		
306								no								Removed	
307								no								Removed	
308	Cedrus atlantica - Atlantic Cedar	10.2	Good	Good	High	Advanced Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	>30 years		

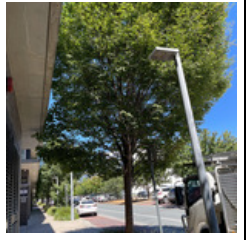
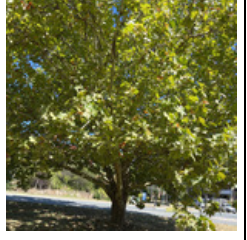
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
309	Picea abies - Norway Spruce	1.8	Good	Good	High	Semi-Mature	15.71	yes	0.6	0.98	6	5	5.5	4	>30 years		
310	Picea abies - Norway Spruce	10.3	Reasonable	Good	High	Advanced Mature	119.38	yes	4.56	2.29	14	38.02	41.82	12	>30 years		
311	Picea abies - Norway Spruce	4.6	Reasonable	Good	High	Mature	31.42	yes	1.2	1.31	7	10.01	11.01	5	>30 years		
312	Cedrus atlantica - Atlantic Cedar	10.5	Good	Good	High	Advanced Mature	172.79	yes	6.6	2.68	16	55.03	60.53	14	>30 years		

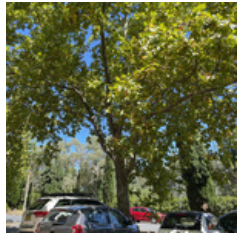
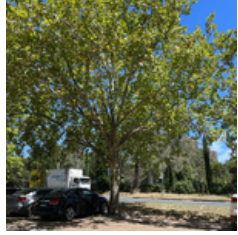
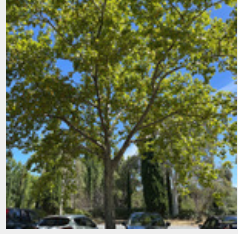
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
313	Cedrus atlantica - Atlantic Cedar	13	Good	Good	High	Advanced Mature	267.04	yes	10.21	3.22	18	85.04	93.55	16	>30 years		
314	Zelkova serrata - Zelkova	7.5	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
315	Pyrus ussuriensis - Manchurian Pear	5.3	Good	Good	High	Mature	125.66	yes	4.8	2.34	9	40.02	44.02	7	10-30 years		
316	Zelkova serrata - Zelkova	7.2	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		

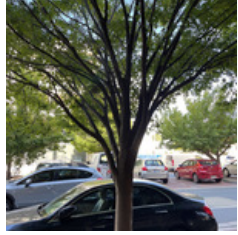
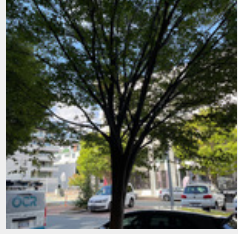
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
317	Zelkova serrata - Zelkova	7.6	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
318	Platanus x acerifolia - London Plane Tree	10.8	Good	Good	High	Mature	94.25	yes	3.6	2.08	16	30.02	33.02	14	>30 years		
319	Platanus x acerifolia - London Plane Tree	11.3	Good	Good	High	Mature	219.91	yes	8.4	2.97	18	70.04	77.04	16	>30 years		
320	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	172.79	yes	6.6	2.68	22	55.03	60.53	20	>30 years		

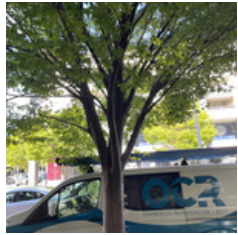
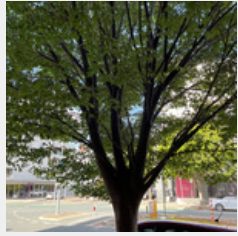
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
321	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	141.37	yes	5.4	2.46	20	45.02	49.52	18	>30 years		
322	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	157.08	yes	6	2.58	22	50.03	55.03	20	>30 years		
323	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	157.08	yes	6	2.58	20	50.03	55.03	18	>30 years		
324	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	141.37	yes	5.4	2.46	21	45.02	49.52	19	>30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
325	Platanus x acerifolia - London Plane Tree	16	Good	Good	High	Advanced Mature	125.66	yes	4.8	2.34	18	40.02	44.02	16	>30 years		
326	Zelkova serrata - Zelkova	7	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
327	Zelkova serrata - Zelkova	6.5	Good	Good	High	Mature	31.42	yes	1.2	1.31	8	10.01	11.01	6	10-30 years		
328	Zelkova serrata - Zelkova	6.5	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		

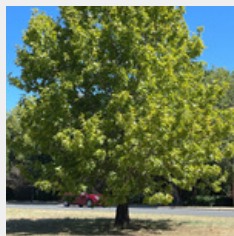
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
329	Zelkova serrata - Zelkova	7	Good	Good	High	Mature	53.41	yes	2.04	1.64	9	17.01	18.71	7	10-30 years		
330	Zelkova serrata - Zelkova	6.5	Good	Good	High	Mature	47.12	yes	1.8	1.55	8	15.01	16.51	6	10-30 years		
333	Pyrus ussuriensis - Manchurian Pear	6	Good	Good	High	Mature	62.83	yes	2.4	1.75	9	20.01	22.01	7	10-30 years	Lower branch has snapped of previously.	
334	Platanus x acerifolia - London Plane Tree	8	Good	Good	High	Mature	72.26	yes	2.76	1.86	10	23.01	25.31	8	>30 years		

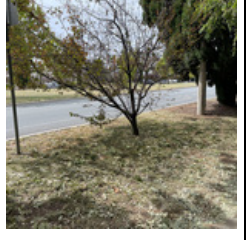
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
335	Platanus x acerifolia - London Plane Tree	9.9	Good	Good	High	Mature	97.39	yes	3.72	2.11	10	31.02	34.12	8	>30 years		
336	Platanus x acerifolia - London Plane Tree	7.5	Good	Good	High	Mature	65.97	yes	2.52	1.79	9	21.01	23.11	7	>30 years		
337	Platanus x acerifolia - London Plane Tree	8	Good	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	>30 years		
338	Platanus x acerifolia - London Plane Tree	7.7	Good	Good	High	Mature	65.97	yes	2.52	1.79	11	21.01	23.11	9	>30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
339	Platanus x acerifolia - London Plane Tree	10.1	Good	Good	High	Mature	103.67	yes	3.96	2.16	14	33.02	36.32	12	>30 years		
340	Platanus orientalis - Oriental Plane Tree	8.8	Good	Good	High	Mature	94.25	yes	3.6	2.08	11	30.02	33.02	9	>30 years		
341	Platanus x acerifolia - London Plane Tree	9.3	Good	Good	High	Mature	100.53	yes	3.84	2.13	12	32.02	35.22	10	>30 years	Tree is obstructing street sign	
342	Platanus x acerifolia - London Plane Tree	7.6	Good	Good	High	Mature	78.54	yes	3	1.92	10	25.01	27.51	8	>30 years		

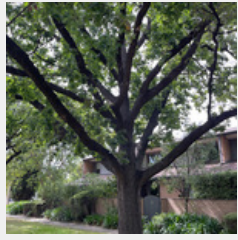
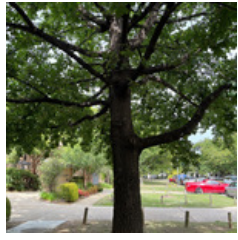
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
343	Platanus x acerifolia - London Plane Tree	10.9	Good	Good	High	Mature	106.81	yes	4.08	2.19	12	34.02	37.42	10	>30 years		
344	Cupressus sempervirens 'Stricta'. - Italian Cypress	11.8	Good	Good	High	Advanced Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		
345	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Reasonable	Good	High	Mature	25.13	yes	0.96	1.19	7	8	8.8	5	10-30 years		
346	Cupressus sempervirens 'Stricta'. - Italian Cypress	8.5		Good	High	Mature	219.91	yes			5			3	10-30 years		
347	Prunus 'Nigra' - Purple Cherry-Plum	4	Good	Good	High	Mature	25.13	yes	0.96	1.19	8	8	8.8	6	10-30 years	Tree is obstructing sign.	

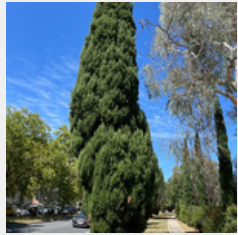
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
348	Cupressus sempervirens 'Stricta'. - Italian Cypress	9.7	Good	Good	High	Advanced Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		
349								no								Removed	
350	Cupressus sempervirens 'Stricta'. - Italian Cypress	12.3	Good	Good	High	Advanced Mature	282.74	yes	10.81	3.3	4	90.04	99.05	2	>30 years		
351								no								Removed	

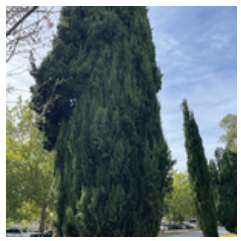
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
352	Cupressus sempervirens 'Stricta' - Italian Cypress	12.7	Good	Good	High	Advanced Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		
353	Quercus robur - English Oak	11.1	Good	Good	High	Mature	141.37	yes	5.4	2.46	16	45.02	49.52	14	>30 years		
354	Quercus robur - English Oak	13	Good	Good	High	Mature	172.79	yes	6.6	2.68	24	55.03	60.53	22	>30 years		
355	Quercus robur - English Oak	11	Good	Good	High	Mature	109.96	yes	4.2	2.22	14	35.02	38.52	12	>30 years	Roots are starting to lift up sidewalk	

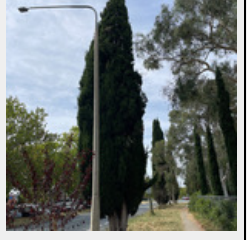
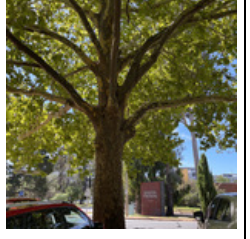
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
356	Cupressus sempervirens 'Stricta' - Italian Cypress	14.6	Good	Good	High	Mature	188.5	yes	7.2	2.78	4	60.03	66.04	2	>30 years		
357	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Good	Good	High	Mature	31.42	yes	1.2	1.31	9	10.01	11.01	7	10-30 years		
358	Cupressus sempervirens 'Stricta' - Italian Cypress	5.6	Good	Good	High	Mature	31.42	yes	1.2	1.31	4	10.01	11.01	2	>30 years		
359	Cupressus sempervirens 'Stricta' - Italian Cypress	13.2	Good	Good	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		

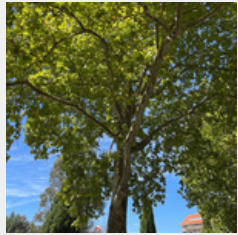
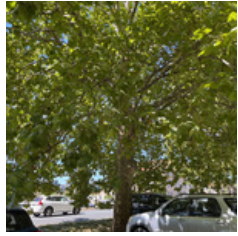
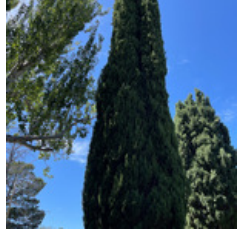
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
360	Prunus 'Nigra' - Purple Cherry-Plum	3.5	Good	Good	High	Mature	25.13	yes	0.96	1.19	8	8	8.8	6	10-30 years		
361	Cupressus sempervirens 'Stricta' - Italian Cypress	11	Good	Good	High	Mature	157.08	yes	6	2.58	4	50.03	55.03	2	>30 years		
362								no								Removed	
363	Cupressus sempervirens 'Stricta' - Italian Cypress	5	Good	Good	High	Mature	31.42	yes	1.2	1.31	4	10.01	11.01	2	>30 years		

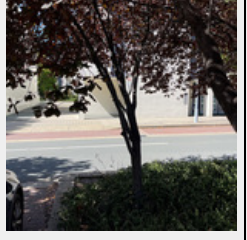
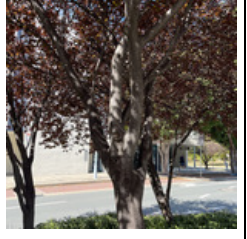
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
364	Prunus 'Nigra' - Purple Cherry-Plum		Dead					no			9			7		Dead	
365	Cupressus sempervirens 'Stricta'. - Italian Cypress	9.4	Good	Good	High	Mature	125.66	yes	4.8	2.34	4	40.02	44.02	2	>30 years		
366	Cupressus sempervirens 'Stricta'. - Italian Cypress	13.7	Good	Good	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		
367	Platanus x acerifolia - London Plane Tree	24	Good	Good	High	Advanced Mature	254.47	yes	9.72	3.15	20	81.04	89.15	18	>30 years		

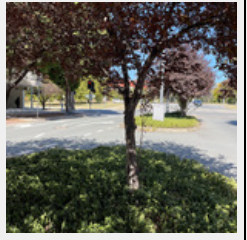
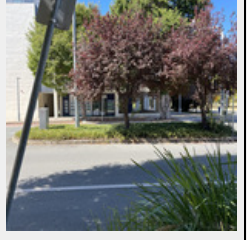
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
368	Platanus x acerifolia - London Plane Tree	24.3	Good	Good	High	Advanced Mature	204.2	yes	7.8	2.88	20	65.03	71.54	18	>30 years		
369	Platanus x acerifolia - London Plane Tree	21.5	Good	Good	High	Advanced Mature	204.2	yes	7.8	2.88	19	65.03	71.54	17	>30 years		
370	Cupressus sempervirens 'Stricta' - Italian Cypress	13.3	Reasonable	Good	High	Mature	204.2	yes	7.8	2.88	4	65.03	71.54	2	>30 years		
371	Cupressus sempervirens 'Stricta' - Italian Cypress	23.6	Good	Good	High	Advanced Mature	370.71	yes	14.17	3.69	4	118.06	129.87	2	>30 years		

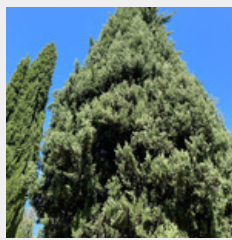
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
372	Populus alba - Silver Poplar	26.9	Good	Good	High	Advanced Mature	386.42	yes	14.77	3.76	16	123.06	135.37	14	10-30 years		
373	Cupressus sempervirens 'Stricta' - Italian Cypress	23.7	Reasonable	Good	High	Mature	210.49	yes	8.04	2.91	4	67.04	73.74	2	>30 years		
375	Prunus 'Nigra' - Purple Cherry-Plum	4.8	Good	Good	High	Mature	61.26	yes	2.34	1.73	10	19.51	21.46	8	10-30 years		
377	Prunus 'Nigra' - Purple Cherry-Plum	5.6	Good	Good	High	Mature	54.98	yes	2.1	1.66	9	17.51	19.26	7	10-30 years		

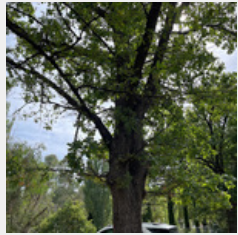
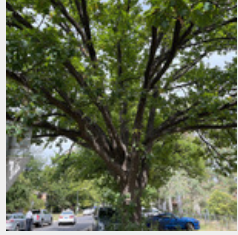
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
378	Prunus 'Nigra' - Purple Cherry-Plum	4.8	Good	Good	High	Mature	50.27	yes	1.92	1.6	10	16.01	17.61	8	10-30 years		
379	Prunus 'Nigra' - Purple Cherry-Plum	4.8	Good	Good	High	Mature	75.4	yes	2.88	1.89	10	24.01	26.41	8	10-30 years		
380	Prunus 'Nigra' - Purple Cherry-Plum	4.7	Good	Good	High	Mature	64.4	yes	2.46	1.77	10	20.51	22.56	8	10-30 years		
381	Prunus 'Nigra' - Purple Cherry-Plum	4.9	Good	Good	High	Mature	78.54	yes	3	1.92	10	25.01	27.51	8	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
382	Cupressus sempervirens 'Stricta'. - Italian Cypress	13.5	Good	Good	High	Mature	282.74	yes	10.81	3.3	4	90.04	99.05	2	>30 years		
383	Cupressus sempervirens 'Stricta'. - Italian Cypress	16.7	Good	Excellent	High	Mature	219.91	yes	8.4	2.97	4	70.04	77.04	2	>30 years		
384								no								Removed	
385	Populus nigra 'Italica' - Lombardy Poplar		Dead					no								Tree fell over. Only stump remain	

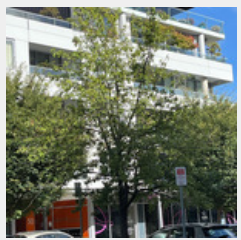
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
386	Quercus robur - English Oak	13	Good	Good	High	Mature	157.08	yes	6	2.58	16	50.03	55.03	14	>30 years		
387	Quercus robur - English Oak	12.1	Good	Good	High	Mature	157.08	yes	6	2.58	16	50.03	55.03	14	>30 years		
388	Quercus robur - English Oak	12.6	Good	Good	High	Mature	172.79	yes	6.6	2.68	20	55.03	60.53	18	>30 years		
389	Acacia decurrens - Black Wattle	6.4	Good	Good	High	Advanced Mature	47.12	yes	1.8	1.55	10	15.01	16.51	8	>30 years		

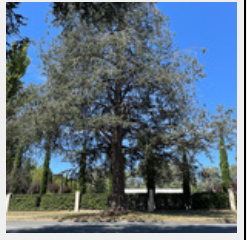
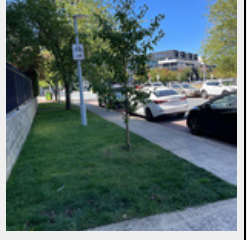
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
390	Cupressus sempervirens 'Stricta' - Italian Cypress	12.4	Good	Good	High	Mature	157.08	yes	6	2.58	4	50.03	55.03	2	>30 years		
391	Prunus 'Nigra' - Purple Cherry-Plum	3.8	Reasonable	Good	High	Mature	25.13	yes	0.96	1.19	7	8	8.8	5	10-30 years		
392	Cupressus sempervirens 'Stricta' - Italian Cypress	13.1	Good	Good	High	Mature	157.08	yes	6	2.58	4	50.03	55.03	2	>30 years		
393	Prunus 'Nigra' - Purple Cherry-Plum	2.3	Good	Good	High	Mature	15.71	yes	0.6	0.98	6	5	5.5	4	10-30 years		

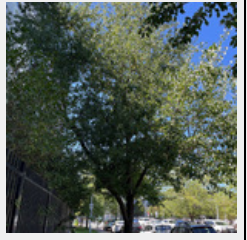
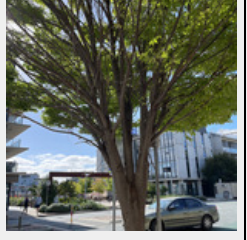
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
394	Pyrus ussuriensis - Manchurian Pear	7.4	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	9	20.01	22.01	7	10-30 years		
395	Cupressus sempervirens 'Stricta' - Italian Cypress	13.1	Good	Good	High	Mature	141.37	yes	5.4	2.46	4	45.02	49.52	2	>30 years	Tree is obstructing light pole	
396	Picea abies - Norway Spruce	18.2	Reasonable	Good	High	Advanced Mature	251.33	yes	9.6	3.14	22	80.04	88.05	20	>30 years		
397	Prunus 'Nigra' - Purple Cherry-Plum		Dead					no			11			9		Dead	

Preliminary Assessment Report

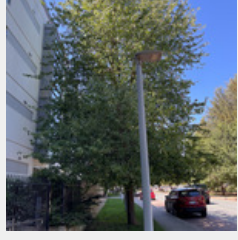
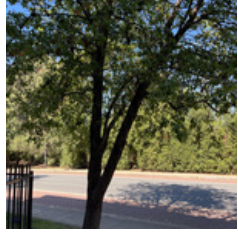
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
398	Picea abies - Norway Spruce	19.9	Reasonable	Good	High	Advanced Mature	282.74	yes	10.81	3.3	18	90.04	99.05	16	>30 years		
399	Prunus 'Nigra' - Purple Cherry-Plum		Dead					no			14			12		Dead	
400	Pyrus ussuriensis - Manchurian Pear	3	Good	Excellent	Excellent	Semi-Mature	12.57	yes	0.48	0.89	5	4	4.4	3	>30 years		
401	Pyrus ussuriensis - Manchurian Pear	13	Good	Good	High	Mature	94.25	yes	3.6	2.08	14	30.02	33.02	12	10-30 years		

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
402	Pyrus ussuriensis - Manchurian Pear	14	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	15	35.02	38.52	13	10-30 years	Wound from recently snapped branch	
403	Pyrus ussuriensis - Manchurian Pear	14	Reasonable	Good	High	Mature	109.96	yes	4.2	2.22	14	35.02	38.52	12	10-30 years		
404	Zelkova serrata - Zelkova	10.5	Good	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
405	Zelkova serrata - Zelkova	9.5	Good	Good	High	Mature	125.66	yes	4.8	2.34	10	40.02	44.02	8	10-30 years		

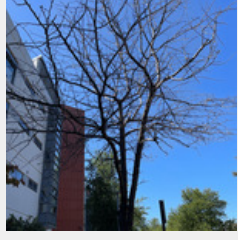
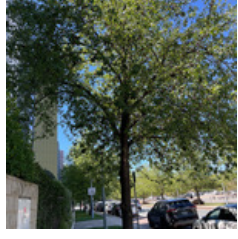
Preliminary Assessment Report



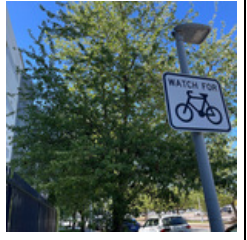
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
407	Pyrus ussuriensis - Manchurian Pear	5.5	Good	Good	High	Mature	62.83	yes	2.4	1.75	9	20.01	22.01	7	10-30 years		
408	Pyrus ussuriensis - Manchurian Pear	6.7	Good	Good	High	Mature	157.08	yes	6	2.58	10	50.03	55.03	8	10-30 years		
409	Pyrus ussuriensis - Manchurian Pear	15	Good	Excellent	High	Mature	87.96	yes	3.36	2.02	13	28.01	30.81	11	10-30 years	Lower limbs obstructing parking sign. Scar when branch has snapped off previously.	
410	Pyrus ussuriensis - Manchurian Pear	13	Reasonable	Good	High	Mature	141.37	yes	5.4	2.46	14	45.02	49.52	12	10-30 years		

Preliminary Assessment Report

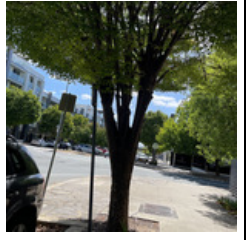
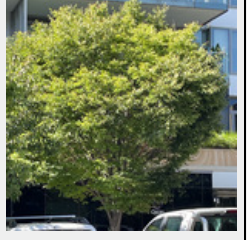
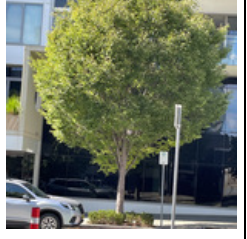


Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
411	Pyrus ussuriensis - Manchurian Pear	13	Good	Good	High	Mature	94.25	yes	3.6	2.08	13	30.02	33.02	11	10-30 years	Lower hanging branches on roadside maybe obstructing parking sign.	
412	Pyrus ussuriensis - Manchurian Pear	15	Reasonable	Good	High	Mature	100.53	yes	3.84	2.13	14	32.02	35.22	12	10-30 years	wound on trunk from previous snapped of branch.	
413	Pyrus ussuriensis - Manchurian Pear	9	Dead	Poor	Poor	Mature	65.97	yes	2.52	1.79	11	21.01	23.11	9		Dead Remove the tree	
414	Pyrus ussuriensis - Manchurian Pear	14	Reasonable	Good	High	Mature	94.25	yes	3.6	2.08	14	30.02	33.02	12	10-30 years		

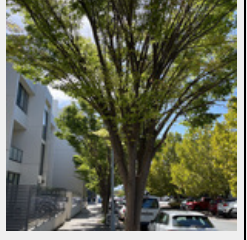
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
415	Pyrus ussuriensis - Manchurian Pear	14	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	14	40.02	44.02	12	10-30 years		
416	Pyrus ussuriensis - Manchurian Pear	13	Reasonable	Good	High	Mature	116.24	yes	4.44	2.27	13	37.02	40.72	11	10-30 years		
417	Zelkova serrata - Zelkova	12	Good	Good	High	Mature	251.33	yes	9.6	3.14	12	80.04	88.05	10	10-30 years		
418	Zelkova serrata - Zelkova	10.5	Good	Good	High	Mature	188.5	yes	7.2	2.78	12	60.03	66.04	10	10-30 years		

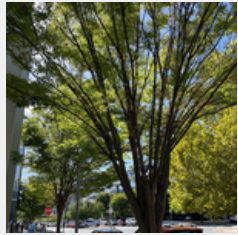
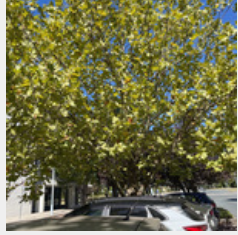
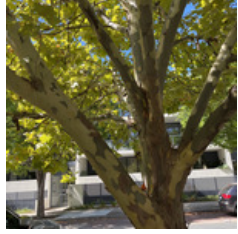
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
419	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	188.5	yes	7.2	2.78	12	60.03	66.04	10	10-30 years		
420	Zelkova serrata - Zelkova	10.5	Good	Good	High	Mature	157.08	yes	6	2.58	12	50.03	55.03	10	10-30 years		
421	Zelkova serrata - Zelkova	7.8	Good	Good	High	Mature	125.66	yes	4.8	2.34	10	40.02	44.02	8	10-30 years		
422	Zelkova serrata - Zelkova	8	Good	Good	High	Mature	109.96	yes	4.2	2.22	10	35.02	38.52	8	10-30 years		

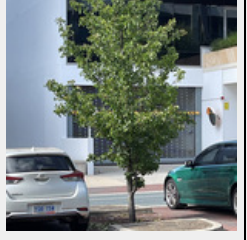
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
423	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	94.25	yes	3.6	2.08	11.5	30.02	33.02	9.5	10-30 years		
424	Zelkova serrata - Zelkova	9.5	Good	Good	High	Mature	78.54	yes	3	1.92	9	25.01	27.51	7	10-30 years	Roots have been cut, and are close to coms pit.	
425	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	125.66	yes	4.8	2.34	10	40.02	44.02	8	10-30 years		
426	Zelkova serrata - Zelkova	11	Good	Good	High	Mature	157.08	yes	6	2.58	10	50.03	55.03	8	10-30 years		

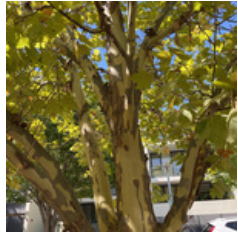
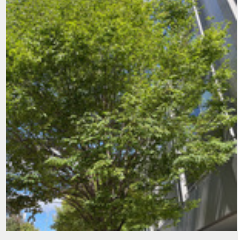
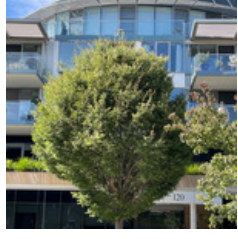
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
427	Zelkova serrata - Zelkova	9.5	Good	Good	High	Mature	188.5	yes	7.2	2.78	12	60.03	66.04	10	10-30 years		
428	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	141.37	yes	5.4	2.46	11	45.02	49.52	9	10-30 years		
429	Platanus x acerifolia - London Plane Tree	9.5	Good	Good	High	Mature	94.25	yes	3.6	2.08	12.5	30.02	33.02	10.5	>30 years		
430	Platanus x acerifolia - London Plane Tree	10	Good	Good	High	Mature	188.5	yes	7.2	2.78	13	60.03	66.04	11	>30 years		

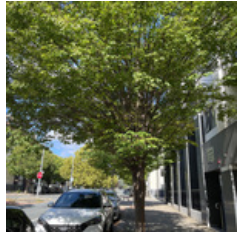
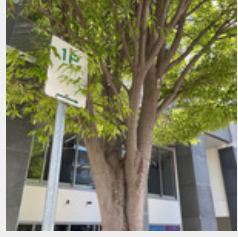
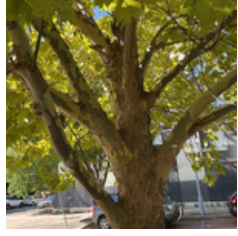
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
431	Zelkova serrata - Zelkova	10.4	Reasonable	Good	High	Mature	125.66	yes	4.8	2.34	10.5	40.02	44.02	8.5	10-30 years		
432	Zelkova serrata - Zelkova	9	Good	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
433	Pyrus ussuriensis - Manchurian Pear	5	Good	Good	High	Mature	31.42	yes	1.2	1.31	6	10.01	11.01	4	10-30 years		
434	Pyrus ussuriensis - Manchurian Pear	4.5	Reasonable	Good	High	Mature	62.83	yes	2.4	1.75	7	20.01	22.01	5	10-30 years		

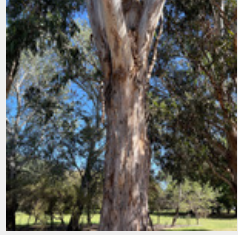
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
435	Pyrus ussuriensis - Manchurian Pear	6	Good	Good	High	Mature	62.83	yes	2.4	1.75	9	20.01	22.01	7	10-30 years		
436	Platanus x acerifolia - London Plane Tree	9.5	Good	Good	High	Mature	94.25	yes	3.6	2.08	13	30.02	33.02	11	>30 years		
437	Zelkova serrata - Zelkova	9.5	Good	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
438	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	94.25	yes	3.6	2.08	10.5	30.02	33.02	8.5	10-30 years		

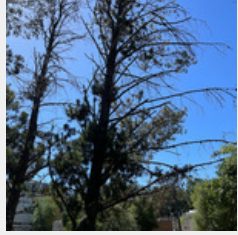
Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
439	Pyrus ussuriensis - Manchurian Pear	5.5	Good	Good	High	Mature	94.25	yes	3.6	2.08	10	30.02	33.02	8	10-30 years		
440	Zelkova serrata - Zelkova	9.5	Good	Good	High	Mature	78.54	yes	3	1.92	10	25.01	27.51	8	10-30 years		
441	Zelkova serrata - Zelkova	9	Reasonable	Good	High	Mature	78.54	yes	3	1.92	10	25.01	27.51	8	10-30 years	Tree has split forming in centre union.	
442	Platanus x acerifolia - London Plane Tree	10.5	Good	Good	High	Mature	109.96	yes	4.2	2.22	13	35.02	38.52	11	>30 years		

Preliminary Assessment Report

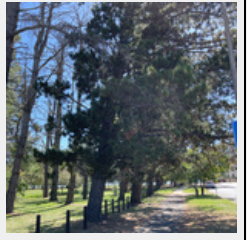
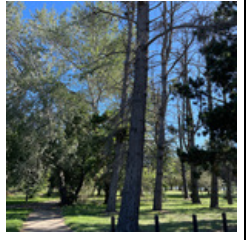
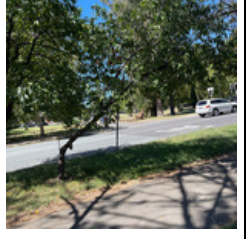
Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
443	Zelkova serrata - Zelkova	10	Good	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
444	Platanus x acerifolia - London Plane Tree	15	Good	Good	High	Advanced Mature	135.09	yes	5.16	2.42	17	43.02	47.32	15	>30 years		
445	Eucalyptus bicostata - Blue Gum	35	Reasonable	Good	High	Advanced Mature	282.74	yes	10.81	3.3	24	90.04	99.05	22	10-30 years	Wood decay present in unions of first order branches. recommend 30% end reduction on the branch over road.	
446	Eucalyptus bicostata - Blue Gum	25	Reasonable	Good	High	Mature	235.62	yes	9	3.05	14	75.04	82.54	12	10-30 years	Second leader branch has broken off previously.	

Preliminary Assessment Report

Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
447	Pinus radiata - Monterey Pine	23	Reasonable	Good	High	Advanced Mature	204.2	yes	7.8	2.88	13	65.03	71.54	11	10-30 years		
448	Pinus radiata - Monterey Pine		Dead					no			14			12		Dead	
449	Pinus radiata - Monterey Pine	25	Moderate	Fair	Medium	Advanced Mature	188.5	yes	7.2	2.78	16	60.03	66.04	14	10-30 years	Tree is staring to decline and die off.	
450	Pinus radiata - Monterey Pine	25	Moderate	Fair	Medium	Advanced Mature	204.2	yes	7.8	2.88	14	65.03	71.54	12	10-30 years	Tree is declining and starting to die off.	

Preliminary Assessment Report



Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
451	Pinus radiata - Monterey Pine	21	Reasonable	Good	High	Advanced Mature	188.5	yes	7.2	2.78	17	60.03	66.04	15	10-30 years	Obstructing light post.	
452	Pinus radiata - Monterey Pine							no			12			10		Dead	
453	Malus sp. - Crab Apple	4	Good	Good	High	Mature	62.83	yes	2.4	1.75	10	20.01	22.01	8	10-30 years		
454	Malus sp. - Crab Apple	4	Reasonable	Good	Medium	Mature	47.12	yes	1.8	1.55	9	15.01	16.51	7	10-30 years		

Preliminary Assessment Report



Tree ID	Species	Height	Health	Condition	Quality	Age	Circ at 1.4m(cm)	Protected	ITPZ(m)	ISRZ(m)	ACT-ITPZ(m)	DBH(cm)	DGL(cm)	Canopy Diameter	Life Expectancy	Comments	Tree Photo
455	Cupressus sempervirens 'Stricta' - Italian Cypress	4	Good	Good	High	Semi-Mature	25	yes	0.96	1.19	2.4	7.96	8.76	0.4	10-30 years		

Preliminary Assessment Report



Tree Health	Good – In good health and appears to be free of significant faults, defects or stress factors. Reasonable—Tree appears to have average vigour for its species and site conditions and appears to be free of significant faults, defects or stress factors. Moderate – Tree presents some faults or health problems which can be managed and are unlikely to cause problems in the short term. Poor – Significant issues with health or structural defects with management unlikely to be adequate or appropriate.
--------------------	---

Condition Rating	Tree Structure
Excellent	• Root plate undisturbed • Buttressing has normal development. • No visible trunk defects or cavities. • Branch spacing/structure and attachments are free of any defects. • Excellent form, very well-balanced crown with excellent density for species. • Trunk is sound and solid. Little to no dieback (deadwood 5% or less) • No apparent pest problems.
Good	• Root plate appears normal; little to no damage present. • Minor trunk defects, with good closure and wound wood development. • Good branch habit, good form and symmetry. • Minimal dieback (5-15% deadwood), with some signs of previous pruning. • Canopy density good for species and location. Minor to no pest problems.
Fair	• Root plate reveals previous damage or disturbance with dysfunctional roots likely, may be visible around main stem, basal wounds <50%. • Evidence of trunk damage or cavities with decay or defects present. • Less than 30% of bark sections missing on trunk. • Codominant stems with acute angles or bark inclusion may be present. Branching habit and attachments indicate poor pruning or damage, which requires moderate corrections. Moderate dieback (15-40% deadwood). • Moderate form, Asymmetric canopy. • Possible phototropic or geotropic (lean). • Obvious signs of pest problems contributing to lesser condition however, likely to be treatable. Some decay areas found in main stem and branches.

Preliminary Assessment Report



Poor	• Root plate disturbance and defects indicate major damage, possible girdling roots around the trunk flare, basal wounds in excess of 50% of circumference. • Trunk reveals more than 50% of bark section missing. Branch structure has poor attachments, with several structurally important dead or broken. • Canopy reveals signs of damage or previous topping or lions tailing, with major corrective actions required. • Lacking full crown, significant dieback (40-50% deadwood), especially affecting larger branches. Significant or severe pest problem Extensive decay or hollow.
Very Poor	• Severe damage within the root plate, with root collar exhibiting major defects which could lead to failure or eventual death. • Branching is extremely poor or severely topped • Severe dieback in canopy (>50% deadwood) • Canopy density is extremely low, Severe decay in the trunk and major branches.

Tree Quality Classification	
Excellent (E)	A tree or group of trees that: • has natural or cultural heritage importance; or • has high aesthetic value and will contribute significantly to the surrounding landscape; or • is of outstanding form and condition and is an excellent example of the species; or • has significant scientific value, including ecological importance.
High (H)	A tree that: • is of good form, structure and health; • is without significant defect; and • presents a low hazard/safety risk.
Medium (M)	A tree that: • is of reasonable form, structure and health; and • presents a medium to low hazard/safety risk.
Poor (P)	A tree that; • is of poor form, structure or health is in decline; or • presents a high or very high hazard/safety risk.
Urban Forest Act 2023	